Field Service Bulletin No. 23

Order No.: DD+DIS168.02E

1 piece VDT3J MA1

ADC Solo
Type 5155 / 100

Path Speed CR SP1001
Type 5155 / 200

Rating			When?		
safety relevant	reliability	new function	immediately	next service	as required
	X				**X**

Please file this document in section 13 of your technical documentation

Errors due to defective R/F tag reader

Symptom
Error codes 21296 and 2128B may occur sporadically.

Error 21296:
Reason: No response from the tag reader

Error 2128B:
Reason: No communication with tag reader

printed in Germany 07 / 2002

AGFA

Defect

The tag reader does not work correctly due to a defective chip (named with Δ00036) on the board **(see Figure 1).**

Solution

Exchange the tag reader

- If error code 21296 or error code 2128B occurs

and

- the chip (1) has the imprint **Δ00036**.

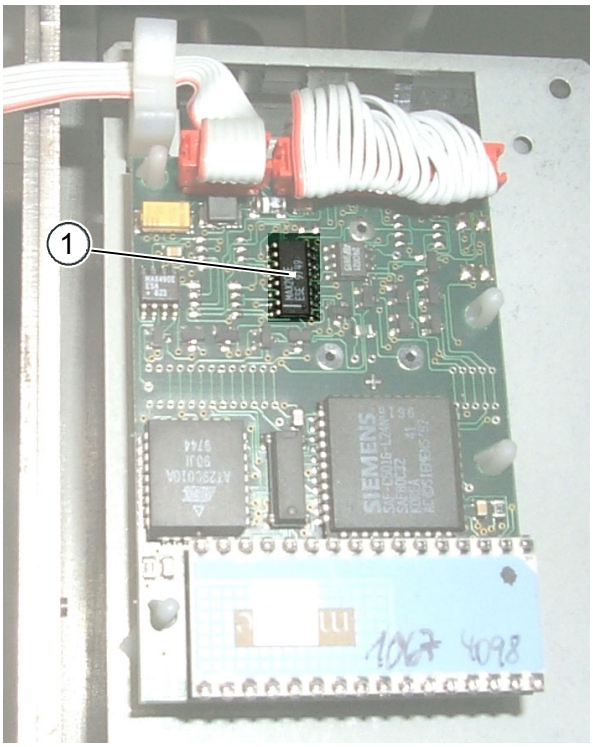

Figure 1

The tag readers on stock have a new chip included.
The spare part number stays: **CM+9.5155.5135.0**.